## **CAMERON BALLOONS LTD and THUNDER & COLT**

## ALERT SERVICE BULLETIN: SB8 ISSUE B (SUPERSEDES ISSUE A)

Title:

Recall of Cylinders.

Parts affected:

Titanium propane cylinders types:

CB2380, serial numbers up to and including BT0143 and CB2383, serial numbers up to and including BT0076.

Reason

The possibility of fatigue cracking of the longitudinal weld on the above cylinder models has been discovered, which if left unattended, could lead to loss of integrity and propane leakage.

Classification:

This Service Bulletin has been classified 'Mandatory' by the

**United Kingdom Civil Aviation Authority.** 

Compliance:

Compliance with the Accomplishment Instructions below is

required immediately on receipt of this bulletin.

Accomplishment Instructions.

(i) Cylinder(s) must not be refilled.

(ii) Cylinder(s) must be emptied of all fuel and depressurised within 7 (seven) days.

(iii) Cylinder(s) must be returned to Cameron Balloons factory \* after emptying.

(iv) Cylinders modified in accordance with Cameron Service Bulletin SB9, at latest issue, may be returned to service.

Note: Cylinders will be rectified by Cameron Balloons Ltd.

\* Contact local dealer or Cameron Balloons Ltd. for delivery arrangements.

In USA, cylinders may be returned to:-

Cameron Balloons US.,

Ann Arbor, Michigan 48106.

Tel (734) 426 5525, fax (734) 426 5026

If in doubt please contact the factory.

Cameron Balloons Ltd /Thunder and Colt

St John's Street Bedminster Bristol BS3 4NH

Tel +44 (0)117 9637216, fax +44 (0)117 9661168

Service Bulletin No. SB8 Issue B Page 1 of 1